

PISCO® Dサブコネクタ DSC取扱説明書

この度は、ピスコ製品をお買い上げいただき誠にありがとうございます。本製品をお客様に安心してお使いいただくために、本取扱説明書を必ずお読みください。また、本書は大切に保管していただきますようお願い申し上げます。

注意事項は、取扱いをあやまった場合に発生する危害や損害の程度により、「危険」、「警告」、「注意」に区分しています。

- 危険** 明らかに危険な状態で、回避しないと死亡もしくは重傷を負う可能性があるもの。
- 警告** 使用状況により危険な状態で、回避しないと死亡もしくは重傷を負う可能性があるもの。
- 注意** 使用状況により危険な状態で、回避しないと軽いもしくは中程度の負傷を負う可能性がある。または財物の損害、損壊の可能性があるもの。

警告
・組立作業、ハンダ付け作業は十分な知識と経験を持った人が行ってください。


注意
・コネクタケースからのケーブル取出し部は過度の屈曲や強い引張力を与えないでください。断線や破損の原因になります。

1. 部品構成




2. 組立手順


- (1). Dサブケーブルのシースを9ピンの場合40～50mm、25ピンの場合60～70mm剥きます。ケーブルに熱収縮チューブを装着した後、コネクタとケーブルのハンダ付けを行ってください。
- ※) ・電線の露出部はコネクタの端子から1mm以下となるようにしてください。
・熱収縮チューブがハンダの熱で収縮しないようご注意ください。

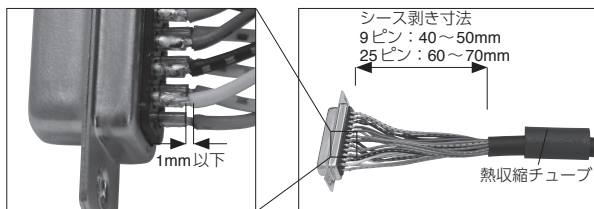


- (2). ハンダ付けしたケーブルをコネクタの中心から左右に分け、M2.6ナベ小ネジ Assy ①を取付けます。
- ※) ・完成時のケーブル取出し方向を考慮してM2.6ナベ小ネジ Assy ①を取付けてください。

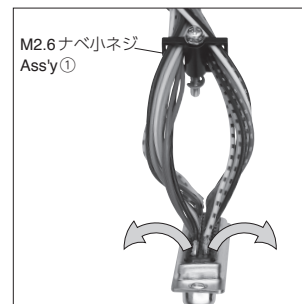


- (3). コネクタケースLに(2)で組立てたケーブルを組込みます。この際、コネクタの突起をコネクタケースのL型保持部に合わせます。また、M2.6ナベ小ネジ Assy ①をコネクタケースの溝に合わせて組込みます。
- ※) ・ケース内は非常に狭くなっており、組込みの際は電線露出部のショートがないことを確認してください。また、ケーブルに引張りなどの強い負荷をかけないようにしてください。

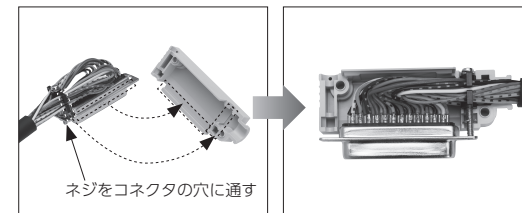


- (4). コネクタケースにM2.6ナベ小ネジ Assy ②を組込みます。
- ※) ・スプリングワッシャをネジ頭側に寄せて組込んでください。

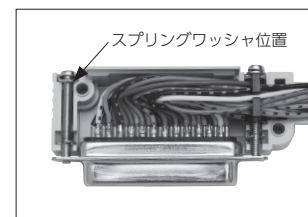


- (5). コネクタケースRを組付けます。
- ※) ・組付け後、手で押さえた際にケースの合わせ目に隙間がないことを確認してください。隙間ができる場合はケーブルの噛み込みが考えられます。

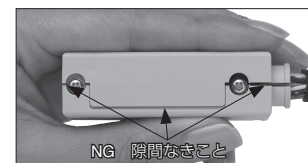

- (6). コネクタケースをM2.5×15ナベ小ネジ及びM2.5ナットで固定します。この際、ケーブル取出し側から先に固定するとケーブルの噛み込みを抑制でき、確実な作業が行えます。
- M2.5ネジ推奨締付トルク=0.3～0.4N・m

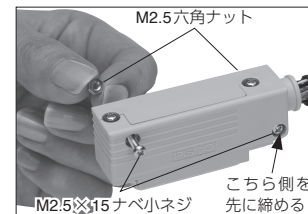

- (7). 熱収縮チューブをヒートガンなどを用いて固定します。
- ※) ・やけどにご注意ください。
・加工後、完全に冷えるまでケーブルを曲げるなど熱収縮チューブに負荷をかけないでください。密着不良の原因となります。

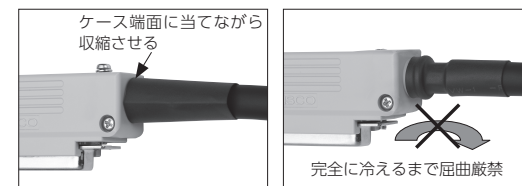

※) その他詳細につきましては、下記までお問い合わせください。

株式会社日本ピスコ

営業部／長野県上伊那郡南箕輪村3884-1 〒399-4586 TEL：0265(76)2511(代) FAX：0265(76)2851 <https://www.pisco.co.jp/>

※) 最寄りの営業所につきましては当社カタログまたは公式Webサイトをご確認ください。

PISCO® Sub-D connector, DSC Instructions manual

Thank you for purchasing PISCO Sub-D connector, DSC. Please make sure to read this Instruction manual before using this product for safety use. Please keep this manual handy with care so you can refer to it whenever necessary.

Safety instructions are classified into "danger", "warning", and "cautions" depending on the grade of damage or danger involved when the safety instructions are not complied with in handling.

! Danger Failure to heed the warning of apparent danger may result in death or serious injuries.


! Warning Failure to heed the warning of conditionally dangerous situations may result in death or serious injuries.

! Caution Failure to heed the warning of conditionally dangerous situations may result in minor or not too serious injuries or damage to properties.

! Warning
• Conduct assembly and soldering of this product by persons with enough knowledge and experience.

! Caution
• Do not give strong pull or extreme bending to the lead wire extracting part from the case.
Doing so may result in lead wires being snapped off and connector components broken.

1. Parts structure

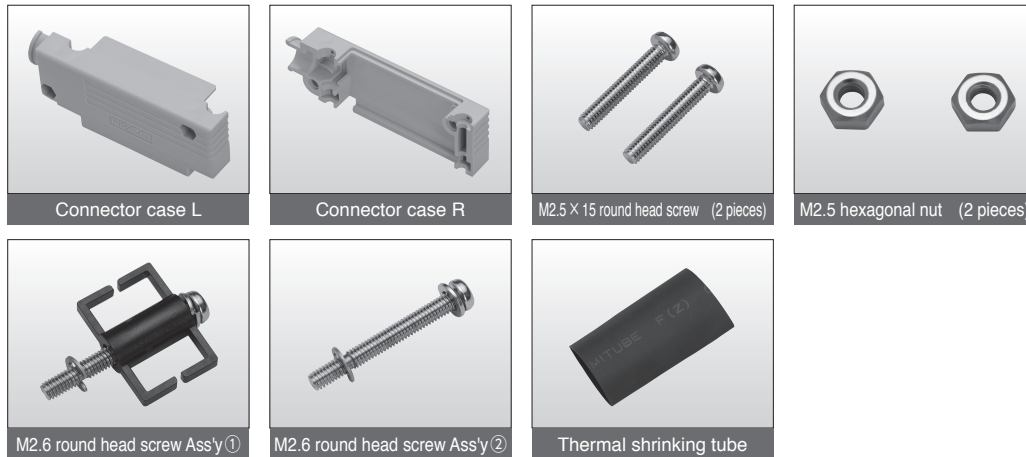


2. Assembly procedure

(1). Strip off 40 ~ 50mm of the cable sheath for 9 pins type and strip off 60 ~ 70mm for 25 pins. Solder the connector and cable after attaching thermal shrinking tube to the cable.


Note) Exposed area of electric wire should be less than or equal to 1mm from the connector terminal.

Make sure that the thermal shrinking tube does not contract by the heat of solder.

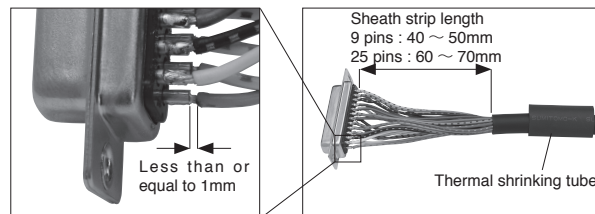


(2). Separate the soldered cables of the right and left from the center of connector and fix M2.6 round head screw Assy ①.

Note) Fix M2.6 round head screw Assy ① with consideration for the cable take out direction at the completion.

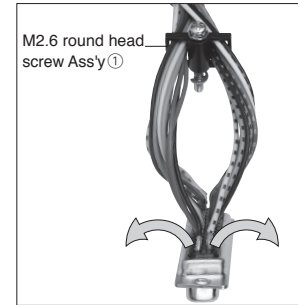


(3). Fit the cable assembled in (2) into connector case L. Position connector's protrusion to L shape holding section of connector case on this occasion. At the same time, set M2.6 round head screw Assy ① in the slot of connector case.

Note) As the room inside of the case is very tight, make sure that there is no short circuit at the exposed area of electric wire. Do not give large load such as pull to the cable.

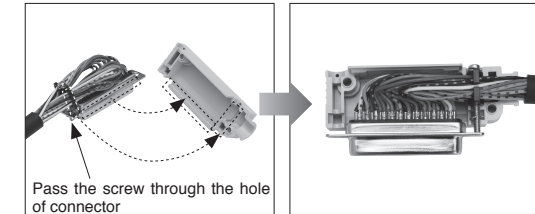


(4). Set M2.6 round head screw Assy ② in the connector case.

Note) Place spring washer close to the head of the screw.

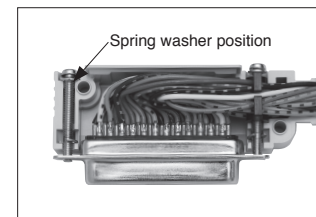


(5). Set connector case R.

Note) After setting the case, make sure that there is no space on the seam of case when holding by hand. If there is space, the cable might be getting stuck.

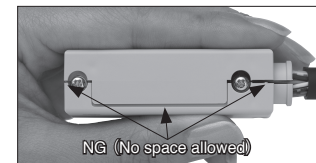

(6). Fix connector case with M2.5 X 15 round head screw and M2.5 hexagonal nut. Fixing cable take out direction first prevents cable getting stuck and enables secure assembly.


Recommended tightening torque of M2.5 screw : 0.3 ~ 0.4N · m

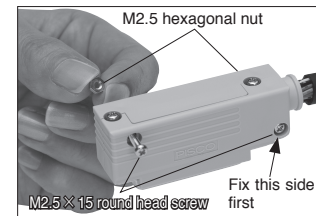

(7). Fix thermal shrinking tube by heat gun or other tools.

Note) Be careful not to burn yourself.

After this process, do not give load such as bending to the thermal shrinking tube until it cools down completely. Otherwise, it causes adhesion failure.

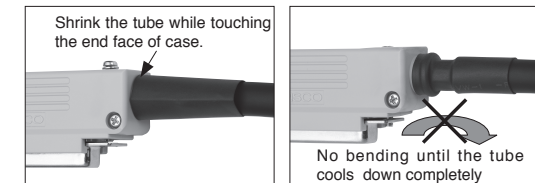

※ Please contact our offices as follows for other details.

NIHON PISCO CO., Ltd.

OVERSEAS SALES TEAM

3884-1 MINAMIMINOWA, KAMIINA, NAGANO-PREF, 399-4588, JAPAN TEL : +81-(0)265-76-7751 FAX : +81-(0)265-76-3305 <https://en.pisco.co.jp/>